



# PCS-1000I

Isolated Output High Precision Current Shunt Meter


## FEATURES

- 6 1/2 Digit Voltage and Current Measurement Resolution
- Simultaneous Current and Voltage Measurement
- Five Current Measurement Levels (AC & DC) : 30mA/300mA/3A/30A/300A
- AC Voltage Measurement Levels : 200mV/2V/20V/200V/600V
- DC Voltage Measurement Levels : 200mV/2V/20V/200V/1000V
- Standard : USB & GPIB
- CE Verification


**GW INSTEK**  
Simply Reliable

GW Instek rolls out the new PCS-1000I isolated output high precision current shunt meter, which inherits the simultaneous voltage and current measurement function of PCS-1000. PCS-1000I adopts five sets of independent shunt resistors to provide five current measurement levels, including 300A, 30A, 3A, 300mA, and 30mA to meet the requirements of different current level measurements. Internally, PCS-1000I utilizes two sets of 24bits ADCs and low temperature coefficient electronic components to mainly focus on the current measurement of power supply devices. High precision PCS-1000I can be used in adjusting and calibrating instruments. Additionally, temperature variation will not cause PCS-1000I to yield any measurement errors. PCS-1000I can automatically select optimal measurement level with the maximum resolution so as to replace manual selection to save operational time.

PCS-1000I provides a BNC output, which can connect with an oscilloscope to directly observe current waveform variation without using a current probe. General oscilloscopes do not have isolated channels and their input and output are structured at a common point, therefore, the output load will likely result in measurement errors. PCS-1000I's isolated current output design can prevent measurement errors from an oscilloscope with non-isolated outputs. PCS-1000I, a high precision AC/DC current shunt meter, not only provides USB and GPIB communications interfaces for users to remotely control the instrument but also conducts simultaneous voltage and current measurements. The SCPI communications commands of PCS-1000I allow users to remotely control PCS-1000I via a PC to operate measurement data readbacks.

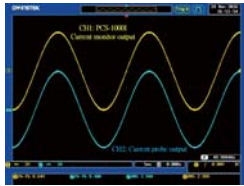


**PCS-1000I vs. Current Probe for Measurement**

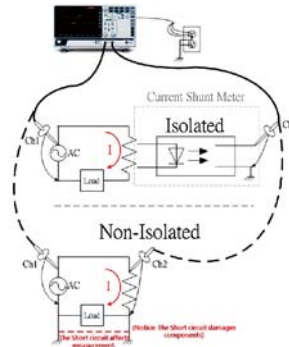

**The measurement issue for Non-Isolated Shunt meter**

**A. SIMULTANEOUS VOLTAGE AND CURRENT MEASUREMENT**

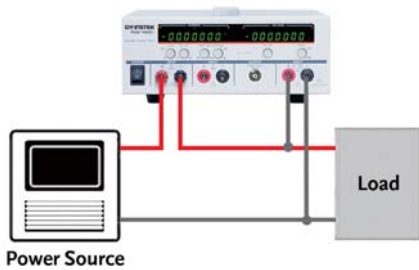


PCS-1000I high precision AC and DC shunt meter can simultaneously measure current and voltage with the maximum 6 1/2 measurement resolution. The above diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

**B. FIVE SETS OF SHUNT RESISTORS TO SWITCH MEASUREMENT**




The switching measurement of five independent shunt resistors provides excellent resolution than that of a single shunt resistor. Under 30mA range, the resolution is 0.01uA, which is ideal for very small current measurement.

**C. REMOTE CONTROL APPLICATION**

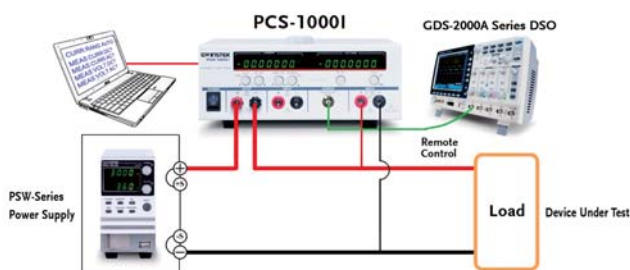

PCS-1000I is not only a high precision AC/DC shunt meter but also provides users with USB and GPIB communications interface so as to remotely control operational sequence. The SCPI commands of PCS-1000I allow users to read back measurement value via a computer remotely controlling PCS-1000I. As shown on the above diagram, the series connection between PCS-1000I and DUT and the parallel connection between voltage input and DUT are arranged to conduct simultaneous voltage and current measurement on DUT. Via the connection between communications and a notebook computer, PCS-1000I can be remotely controlled by operating the notebook computer and edited sequence.

**D. ISOLATED OUTPUT CURRENT OUTPUT DESIGN**

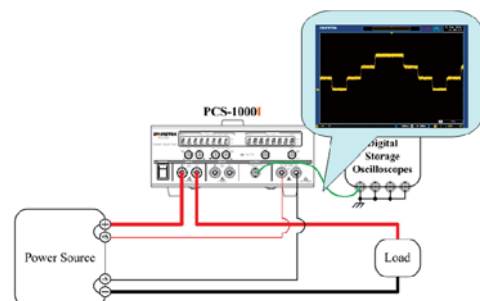

PCS-1000I adopts isolated current output design. Its BNC output can directly connect with an oscilloscope to avoid measurement errors resulted from the common ground of oscilloscope's analog input measurement.

## E. AUTOMATIC RANGE-SWITCHING MEASUREMENT FUNCTION




Press and hold Auto key, PCS-1000I will automatically select the maximum measurement resolution for users to save time in manual selection.

## F. CONNECTION COMPARISON


PCS-1000I can simultaneously measure current and voltage with 6 1/2 measurement resolution. The left diagram shows the connection method of simultaneous measurement. Compared with the test of conventional meters from other brands, PCS-1000I is simple in connection and there is no requirement of any additional instrument.

### PCS-1000i Conducts Simultaneous Voltage and Current Measurement

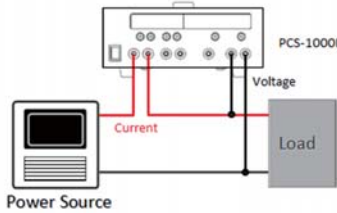


1. Only one PCS-1000I is needed to measure voltage and current
2. Easy connection
3. USB and GPIB communications on the rear panel can be used for data communication while connecting with a PC

### Shunt Resistor Conducts Current and Voltage Measurement

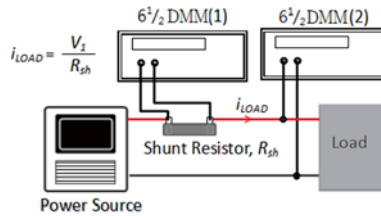

1. One voltage meter is needed to measure voltage on shunt and the voltage will be converted to current. For simultaneous voltage and current measurement, one extra voltage meter is required
2. Complex connection
3. For data communication with a PC, the PC must be connected to two voltage meters

### Conventional Shunt Meter Conducts Current and Voltage Measurement

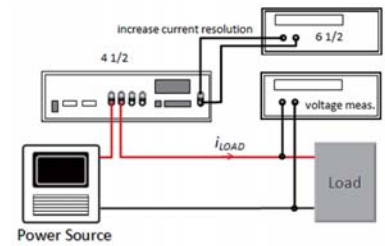

1. This method requires one shunt meter, one current meter to increase current measurement resolution, and one voltage meter to measure voltage
2. Complex connection
3. For data communication with a PC, the PC must be connected to two meters

## PANEL INTRODUCTION



1. Power Switch
2. AC/DC 30A Terminal
3. AC/DC 30A/300mA/30mA Terminal
4. Current Monitor Sensor
5. AC/DC Voltage Terminal
6. Range for Voltage/Enter/Auto
7. AC/DC current range
8. Local/Function
9. Display
10. Power Cord Socket
11. GPIB
12. USB
13. AC/DC 300A Terminal
14. Fan

## SPECIFICATIONS

<b>DC CHARACTERISTICS</b>	<b>DC Voltage</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>1 Year 23 °C ± 5 °C</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>200.0000 mV</td> <td>0.0050 + 0.0035</td> <td>0.0005 + 0.0005</td> </tr> <tr> <td>2.000000 V</td> <td>0.0050 + 0.0010</td> <td>0.0005 + 0.0001</td> </tr> <tr> <td>20.00000 V</td> <td>0.0050 + 0.0010</td> <td>0.0005 + 0.0001</td> </tr> <tr> <td>200.0000 V</td> <td>0.0050 + 0.0010</td> <td>0.0005 + 0.0001</td> </tr> <tr> <td>1000.000 V</td> <td>0.0050 + 0.0020</td> <td>0.0005 + 0.0001</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ±(% of reading + % of range);voltage input resistance: 10MΩ for all DC voltage ranges</p>	Range	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C	200.0000 mV	0.0050 + 0.0035	0.0005 + 0.0005	2.000000 V	0.0050 + 0.0010	0.0005 + 0.0001	20.00000 V	0.0050 + 0.0010	0.0005 + 0.0001	200.0000 V	0.0050 + 0.0010	0.0005 + 0.0001	1000.000 V	0.0050 + 0.0020	0.0005 + 0.0001						
	Range	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C																							
	200.0000 mV	0.0050 + 0.0035	0.0005 + 0.0005																							
	2.000000 V	0.0050 + 0.0010	0.0005 + 0.0001																							
	20.00000 V	0.0050 + 0.0010	0.0005 + 0.0001																							
	200.0000 V	0.0050 + 0.0010	0.0005 + 0.0001																							
	1000.000 V	0.0050 + 0.0020	0.0005 + 0.0001																							
	<b>DC Current</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>Burden Voltage</th> <th>1 Year 23 °C ± 5 °C</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>30.00000 mA</td> <td>&lt; 0.4 V</td> <td>0.01 + 0.005</td> <td>0.001 + 0.002</td> </tr> <tr> <td>300.0000 mA</td> <td>&lt; 0.5 V</td> <td>0.01 + 0.005</td> <td>0.001 + 0.002</td> </tr> <tr> <td>3.000000 A</td> <td>&lt; 0.8 V</td> <td>0.01 + 0.005</td> <td>0.001 + 0.002</td> </tr> <tr> <td>30.00000 A*1</td> <td>&lt; 0.8 V</td> <td>0.01 + 0.005</td> <td>0.001 + 0.002</td> </tr> <tr> <td>300.0000 A*1</td> <td>&lt; 0.8 V</td> <td>0.02 + 0.005</td> <td>0.001 + 0.002</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ± (% of reading + % of range)</p>	Range	Burden Voltage	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C	30.00000 mA	< 0.4 V	0.01 + 0.005	0.001 + 0.002	300.0000 mA	< 0.5 V	0.01 + 0.005	0.001 + 0.002	3.000000 A	< 0.8 V	0.01 + 0.005	0.001 + 0.002	30.00000 A*1	< 0.8 V	0.01 + 0.005	0.001 + 0.002	300.0000 A*1	< 0.8 V	0.02 + 0.005	0.001 + 0.002
	Range	Burden Voltage	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C																						
	30.00000 mA	< 0.4 V	0.01 + 0.005	0.001 + 0.002																						
300.0000 mA	< 0.5 V	0.01 + 0.005	0.001 + 0.002																							
3.000000 A	< 0.8 V	0.01 + 0.005	0.001 + 0.002																							
30.00000 A*1	< 0.8 V	0.01 + 0.005	0.001 + 0.002																							
300.0000 A*1	< 0.8 V	0.02 + 0.005	0.001 + 0.002																							
<b>Isolated DC Current Monitor Accuracy</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>Resolution(6 1/2)</th> <th>DC Accuracy</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>30.00000 mA</td> <td>0.00001 mA</td> <td>0.1 + 0.05</td> <td>0.001</td> </tr> <tr> <td>300.0000 mA</td> <td>0.0001 mA</td> <td>0.1 + 0.05</td> <td>0.001</td> </tr> <tr> <td>3.000000 A</td> <td>0.000001 A</td> <td>0.1 + 0.05</td> <td>0.001</td> </tr> <tr> <td>30.00000 A*1</td> <td>0.00001 A</td> <td>0.1 + 0.05</td> <td>0.001</td> </tr> <tr> <td>300.0000 A*1</td> <td>0.0001 A</td> <td>0.2 + 0.05</td> <td>0.001</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ±(% of output + % of full scale);monitor output voltage for the full scale current = 3V</p>	Range	Resolution(6 1/2)	DC Accuracy	Temperature Coefficient/°C	30.00000 mA	0.00001 mA	0.1 + 0.05	0.001	300.0000 mA	0.0001 mA	0.1 + 0.05	0.001	3.000000 A	0.000001 A	0.1 + 0.05	0.001	30.00000 A*1	0.00001 A	0.1 + 0.05	0.001	300.0000 A*1	0.0001 A	0.2 + 0.05	0.001	
Range	Resolution(6 1/2)	DC Accuracy	Temperature Coefficient/°C																							
30.00000 mA	0.00001 mA	0.1 + 0.05	0.001																							
300.0000 mA	0.0001 mA	0.1 + 0.05	0.001																							
3.000000 A	0.000001 A	0.1 + 0.05	0.001																							
30.00000 A*1	0.00001 A	0.1 + 0.05	0.001																							
300.0000 A*1	0.0001 A	0.2 + 0.05	0.001																							
<b>AC CHARACTERISTICS</b>	<b>True RMS AC Voltage</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>Frequency</th> <th>1 Year 23 °C ± 5 °C</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>200.0000 mV</td> <td rowspan="5" style="text-align: center;">45Hz~2kHz 2kHz~10kHz 10kHz~20kHz</td> <td rowspan="5" style="text-align: center;">0.5 + 0.05 1.0 + 0.05 2.0 + 0.10</td> <td>0.005 + 0.005</td> </tr> <tr> <td>2.000000 V</td> <td>0.005 + 0.005</td> </tr> <tr> <td>20.00000 V</td> <td>0.005 + 0.005</td> </tr> <tr> <td>200.0000 V</td> <td>0.005 + 0.005</td> </tr> <tr> <td>600.000 V</td> <td>0.005 + 0.005</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ±(% of reading + % of range)</p>	Range	Frequency	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C	200.0000 mV	45Hz~2kHz 2kHz~10kHz 10kHz~20kHz	0.5 + 0.05 1.0 + 0.05 2.0 + 0.10	0.005 + 0.005	2.000000 V	0.005 + 0.005	20.00000 V	0.005 + 0.005	200.0000 V	0.005 + 0.005	600.000 V	0.005 + 0.005								
	Range	Frequency	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C																						
	200.0000 mV	45Hz~2kHz 2kHz~10kHz 10kHz~20kHz	0.5 + 0.05 1.0 + 0.05 2.0 + 0.10	0.005 + 0.005																						
	2.000000 V			0.005 + 0.005																						
	20.00000 V			0.005 + 0.005																						
	200.0000 V			0.005 + 0.005																						
	600.000 V			0.005 + 0.005																						
	<b>True RMS AC Current</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>Frequency</th> <th>1 Year 23 °C ± 5 °C</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>30.00000 mA</td> <td rowspan="2" style="text-align: center;">45Hz~2kHz 2kHz~10kHz</td> <td rowspan="2" style="text-align: center;">0.5 + 0.05 1.0 + 0.05</td> <td>0.03 + 0.006</td> </tr> <tr> <td>300.0000 mA</td> <td>0.03 + 0.006</td> </tr> <tr> <td>3.000000 A</td> <td rowspan="3" style="text-align: center;">45Hz~400Hz</td> <td rowspan="3" style="text-align: center;">0.5 + 0.05</td> <td>0.03 + 0.006</td> </tr> <tr> <td>30.00000 A*1</td> <td>0.03 + 0.006</td> </tr> <tr> <td>300.0000 A*1</td> <td>0.03 + 0.006</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ±(% of reading + % of range)</p>	Range	Frequency	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C	30.00000 mA	45Hz~2kHz 2kHz~10kHz	0.5 + 0.05 1.0 + 0.05	0.03 + 0.006	300.0000 mA	0.03 + 0.006	3.000000 A	45Hz~400Hz	0.5 + 0.05	0.03 + 0.006	30.00000 A*1	0.03 + 0.006	300.0000 A*1	0.03 + 0.006						
	Range	Frequency	1 Year 23 °C ± 5 °C	Temperature Coefficient/°C																						
	30.00000 mA	45Hz~2kHz 2kHz~10kHz	0.5 + 0.05 1.0 + 0.05	0.03 + 0.006																						
300.0000 mA	0.03 + 0.006																									
3.000000 A	45Hz~400Hz	0.5 + 0.05	0.03 + 0.006																							
30.00000 A*1			0.03 + 0.006																							
300.0000 A*1			0.03 + 0.006																							
<b>Isolated AC Current Monitor Accuracy</b>	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Range</th> <th>Frequency</th> <th>AC Accuracy</th> <th>Temperature Coefficient/°C</th> </tr> </thead> <tbody> <tr> <td>30.00000 mA</td> <td rowspan="2" style="text-align: center;">45Hz~2kHz 2kHz~10kHz</td> <td rowspan="2" style="text-align: center;">0.2 + 0.05 0.5 + 0.05</td> <td>0.001</td> </tr> <tr> <td>300.0000 mA</td> <td>0.001</td> </tr> <tr> <td>3.000000 A</td> <td rowspan="3" style="text-align: center;">45Hz~400Hz</td> <td rowspan="3" style="text-align: center;">0.5 + 0.05</td> <td>0.001</td> </tr> <tr> <td>30.00000 A*1</td> <td>0.001</td> </tr> <tr> <td>300.0000 A*1</td> <td>0.001</td> </tr> </tbody> </table> <p style="font-size: small;">Accuracy specification : ±(% of output + % of full scale); monitor output voltage for the full scale current = 3V; The specifications are only applicable when the input is 10% or greater of the full scale range</p>	Range	Frequency	AC Accuracy	Temperature Coefficient/°C	30.00000 mA	45Hz~2kHz 2kHz~10kHz	0.2 + 0.05 0.5 + 0.05	0.001	300.0000 mA	0.001	3.000000 A	45Hz~400Hz	0.5 + 0.05	0.001	30.00000 A*1	0.001	300.0000 A*1	0.001							
Range	Frequency	AC Accuracy	Temperature Coefficient/°C																							
30.00000 mA	45Hz~2kHz 2kHz~10kHz	0.2 + 0.05 0.5 + 0.05	0.001																							
300.0000 mA			0.001																							
3.000000 A	45Hz~400Hz	0.5 + 0.05	0.001																							
30.00000 A*1			0.001																							
300.0000 A*1			0.001																							
<b>GENERAL</b>	<b>Power Supply</b>	100 V/120 V/220 V/240 V ±10%																								
	<b>Power Line Frequency</b>	50/60 Hz																								
	<b>Operating Environment</b>	Full accuracy for 0 °C ~ 55 °C, Full accuracy to 80% R.H. at 40 °C																								
	<b>Storage Environment</b>	-40 °C ~ 70 °C																								
	<b>Power Consumption</b>	Max 35VA																								
	<b>Dimensions Weight</b>	210(W) x 80(H) x 390(D)mm ; Approx. 5 kg																								

(The specifications apply when the PCS-1000I is powered on for at least 30 minutes to warm-up to a temperature of 18 °C ~ 28 °C, unless specified otherwise.)

Note: \*1 The accuracy for 30A/300A levels must be increased by a power factor of 8 ppm/watt.

Specifications subject to change without notice. CS1000IGD1BH

### ORDERING INFORMATION

**PCS-1000I** Isolated Output High Precision Current Shunt Meter

#### ACCESSORIES

Quick Operation Guide, User Manual (CD) x 1, AC Power Cord x 1 (Region Dependant),

**GTL-105A** Alligator Clip Test Lead (3A Max)     **GTL-240** USB Cable

**GTL-207** Banana Plug Test Lead     **PCS-001** Basic Accessory Kit

### OPTIONAL ASSESSORIES

**GRA-419-J** Rack Mount Adapter (JIS)

**GRA-419-E** Rack Mount Adapter (EIA)

Global Headquarters  
**GOOD WILL INSTRUMENT CO., LTD.**  
T +886-2-2268-0389 F +886-2-2268-0639

China Subsidiary  
**GOOD WILL INSTRUMENT (SUZHOU) CO., LTD.**  
T +86-512-6661-7177 F +86-512-6661-7277

Malaysia Subsidiary  
**GOOD WILL INSTRUMENT (M) SDN. BHD.**  
T +604-6111122 F +604-6115225

Europe Subsidiary  
**GOOD WILL INSTRUMENT EURO B.V.**  
T +31(0)40-2557790 F +31(0)40-2541194

U.S.A. Subsidiary  
**INSTEK AMERICA CORP.**  
T +1-909-399-3535 F +1-909-399-0819

Japan Subsidiary  
**TEXIO TECHNOLOGY CORPORATION.**  
T +81-45-620-2305 F +81-45-534-7181

Korea Subsidiary  
**GOOD WILL INSTRUMENT KOREA CO., LTD.**  
T +82-2-3439-2205 F +82-2-3439-2207

GW INSTEK

Simply Reliable



[www.gwinstek.com](http://www.gwinstek.com)

[www.facebook.com/GWInstek](https://www.facebook.com/GWInstek)